

# CA 6422 & CA 6424

# **2P & 3P Earth/Ground Testers**



- 2P resistance/3P earth resistance measurement up to  $50 \text{ k}\Omega$  for highly resistive terrain
- Automatic stabilization of the measurement
- Help with placing the stakes average and 52%/62%/72% deviation
- Leakage current measurement from 0.5 mA
- Battery recharging via the mains, USB socket or vehicle cigarette lighter













Measure up



DC\_CA6422-6424\_ed1\_GB.indd 1 20/02/2020 14:34:22


# ERGONOMICS

- A rugged, waterproof casing for intensive, all-terrain use
- Connections with text and coloured markings to avoid any risk of errors
- Detection if a hazardous voltage is present, thus prohibiting measurement

 $\Omega + COM$ 

The CA 6422 & CA 6424 are designed for work in total safety

3 measurement inputs Current measurement: 3P earth: H, S, E G72 clamp input for CA 6424

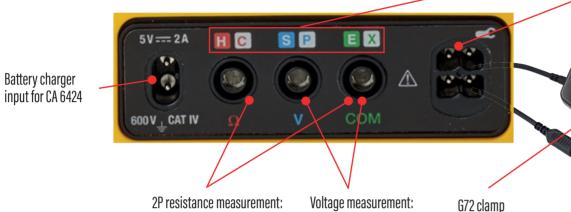



voltage is present, indicating that the

measurement is subject to noise. If the

noise level reaches a dangerous value, the symbol A flashes and measurement

Direct access to all the functions, even when wearing gloves

Wide backlit LCD screen

V + COM

Hazardous voltage LED Function keys

Measurement selection

52%

Test activation, Backlit button

62%

visible in all circumstances

for CA 6424



# OPTIMIZED USE

As soon as it is powered up, the instrument automatically performs a resistance measurement in 2P mode. A short press on the TEST button starts measurements in one-shot 3P mode. A long press on TEST can be used to activate the permanent 3P mode. Internal filtering automatically stabilizes the measurement. As soon as it has stabilized, the result is frozen on the display. A LED indicates the presence of a hazardous voltage which prohibits measurement. If the NOISE symbol flashes, it means that a noise voltage is present. In the event of a noise-filled environment, automatic switching from a frequency of 128 Hz to 256 Hz helps to improve measurement accuracy.

# MEASUREMENTS

#### **Current measurements**

## **Voltage measurements**

As soon as it is connected to the CA 6424, the (optional) G72 clamp is recognized automatically. The CA 6424 then switches to current measurement mode (0.5 mA to 60.00 A).

The CA 6424 displays the value of the voltage between the V and COM








## 2P earth measurements

The automatic startup in 2P resistance mode immediately enables you to test the integrity of the H stake.



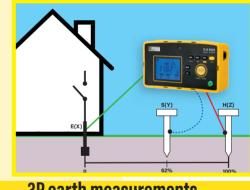





### 3P earth measurements

The 3P earth mode memorizes the 52%, 62% and 72% measurement values and calculates the difference in % in relation to the average. If the difference is too great, the percentage value displayed on screen flashes. The CA 6424 can display the resistance of the stake RH and the voltage USE.



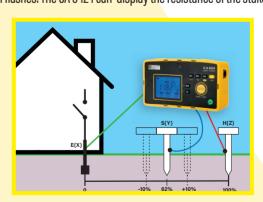



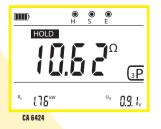

72%

is impossible.

indications

	CA 6422	CA 6424	
Voltage			
Range	-	0.1-600 V	
Resolution	-	0.1 V	
Accuracy	-	± (1%R + 1 ct)	
2P resistance			
Range	0.05-99.99 Ω / 80.0-999.9 Ω / 0.800-9.999 kΩ / 8.00-50.00 kΩ		
Resolution	0.01 \Omega / 1 \Omega ,	0.01 Ω / 1 Ω / 100 Ω	
Accuracy	$\pm$ (2%R + 10 cts) / $\pm$ (2%R + 2 cts	$\pm (2\%R + 10 \text{ cts}) / \pm (2\%R + 2 \text{ cts}) / \pm (2\%R + 1 \text{ ct}) / \pm (2\%R + 1 \text{ ct})$	
Cable compensation	-	up to 5 $\Omega$	
3P earth resistance			
Range	0.5 Ω - 2.000 kΩ	0.5 Ω - 50.00 kΩ	
Resolution	0.01 Ω / 0.1 Ω / 1 Ω	0.01 Ω / 0.1 Ω / 10 Ω	
Accuracy	$\pm (1\%R + 10 \text{ cts}) / \pm (1\%R + 2 \text{ cts}) / \pm (1\%R + 1 \text{ ct})$		
Measurement frequency	128 Hz or 256 Hz		
No-load voltage	±10 V peak		
Measurement mode	One-shot or permanent		
Data storage	Registers: RE @ 62%; RE @ 52%; RE @ 72%		
Calculation of average	•	Calculation of the average and the $\%$ deviation in relation to the average	
RH stake resistance measurement			
Range	-	0.05-9.999 kΩ / 8 - 49.99 kΩ	
Resolution	•	10/100	
Accuracy	-	$\pm (10\%R + 1 ct)$	
U <sub>SE</sub> voltage measurement		040 00001/40 (000 0001/40	
Range	-	0.10 - 99.99 VAC / 80.0 - 600 VAC	
Resolution	-	0.01 V / 0.1 V	
Accuracy	-	±(2%R + 2 cts)	
Current measurement (via optional G72 clamp)		0.5.0000 1.0000 0.000 1.000 0.00 1	
Range	-	0.5 - 999.9 mA / 0.800-9.999 A / 8.00-60.00 A	
Resolution	-	0.1/1/10 mA	
Accuracy General specifications	•	$\pm (1\%R + 4 cts) / \pm (1\%R + 2 cts)$	
Display Backlit custom 206-segment LCD			
Measurement mode	R 2P (Ω), R 3P (Ω)	V, I, R 2P (Ω), R 3P (Ω)	
Power supply	6 x LR 6 or AA batteries	6 x NiMH rechargeable batteries, charging time approx 6 hrs	
Charger	O X LII O OI AA DALLETIES	Internal via mains/USB adapter supplied	
Automatic power-off		Deactivatable	
Battery life	$>$ 2,000 x 3P earth measurements at 100 $\Omega$	$>$ 1,500 x 3P earth measurements at 100 $\Omega$	
Dimensions / weight		70 mm / 1 kg	
Environment	Operation: -10 to +50°C / Storage: -40 to +70°C (without batteries/accumulators)		
Protection	Up to 600 V on any of the input terminals		
IP / IK index	IP 65 as per IEC 60529 / IK 04 as per IEC 50102		
Drop test	1 metre as per IEC 61010-1		
Standards / electrical safety	EMC: IEC 61326-1; IEC 61010-2-030 / 600 V CAT IV		
Compliance with IEC 61557	IEC 61557-1 and IEC 61557-5		
Compilative that its closer			

#### **STATE AT DELIVERY AND REFERENCES**

**CA 6422**Instrument delivered with 6 x LR6 type AAA batteries, 1 quick start guide, 1 safety datasheet, 1 test report with measurement results, WEB link/QR Code for downloading the manuals.

CA 6424 P01127014

Tcarrying bag, 6 NiMH batteries, 1 USB 2A power supply, 1 USB micro-razor power cable, 1 multilingual quick start guide, 1 safety datasheet, 1 battery datasheet, 1 test report with measurement results, WEB link/QR Code for downloading the manuals.

#### **ACCESSORIES AND REPLACEMENT PARTS**



Carrying bag G72 current clamp 4-point hands-free strap 15m earth kit 50m earth kit Wrist strap P01298006 P01120872 HX0302 P01102017 P01102021 HX0122

#### FRANCE Chauvin Arnoux

190, rue Championnet 75876 PARIS Cedex 18 Tél.: +33144854485 Fax: +33146277389 info@chauvin-arnoux.fr www.chauvin-arnoux.fr

#### UNITED KINGDOM Chauvin Arnoux Ltd

Unit 1 Nelson Ct, Flagship Sq, Shaw Cross Business Pk Dewsbury, West Yorkshire - WF12 7TH Tel: +44 1924 460 494 Fax: +44 1924 455 328 info@chauvin-arnoux.co.uk www.chauvin-arnoux.com

#### Middle East

Chauvin Arnoux Middle East P.O. BOX 60-154 1241 2020 JAL EL DIB - LEBANON Tel: +961 1 890 425 Fax: +961 1 890 424 camie@chauvin-arnoux.com www.chauvin-arnoux.com



DC\_CA6422-6424\_edl\_GB.indd 4 20/02/2020 14:34:59